
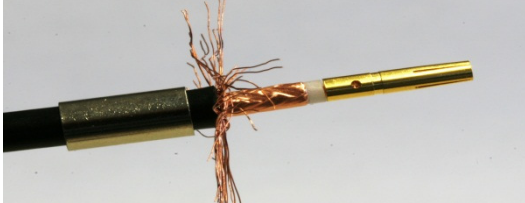

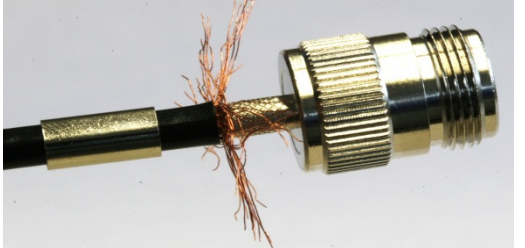

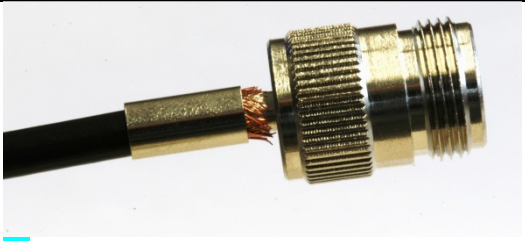
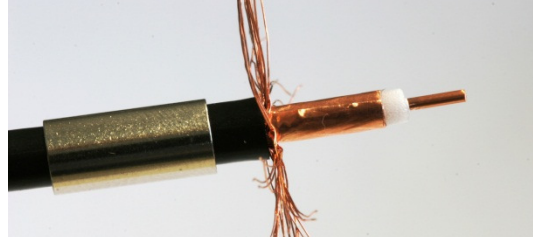
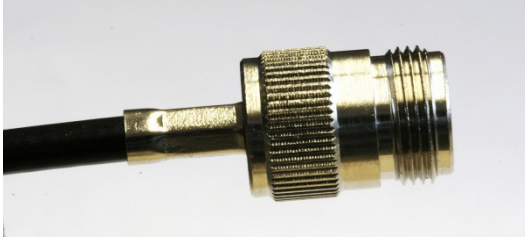


## Mounting instruction

AIRCELL®5

N-Socket, crimp/ Art. No. 7703

 <p><b>1.</b> Cut off cable tail right-angled. Move the crimp-cover over the cable head. Cut off 14 mm of the outer sheathing with a knife.</p>	 <p><b>5.</b> Put the head pin onto the inner conductor and solder it.</p>
 <p><b>2.</b> Bend copper braid upwards right angled.</p>	 <p><b>6.</b> Insert the prepared cable end into the connector housing as far as it will go (Click).</p>
 <p><b>3.</b> Slit slightly a length of 6 mm of the copper foil and remove it.</p>	 <p><b>7.</b> Cut off the copper braid with a side cutter and move the crimp jacket to the front.</p>
 <p><b>4.</b> Remove 4 mm of the dielectric.</p>	 <p><b>8.</b> Crimp the crimp jacket with a crimp tool; herewith the copper braid will be trapped between the crimp jacket and the connector housing.</p>