

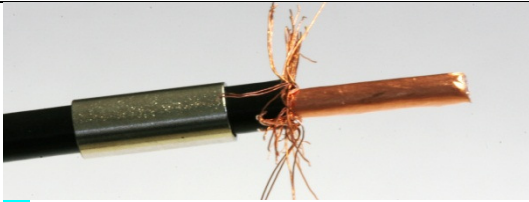
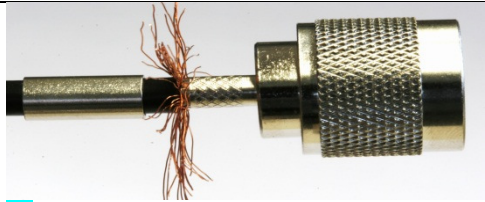
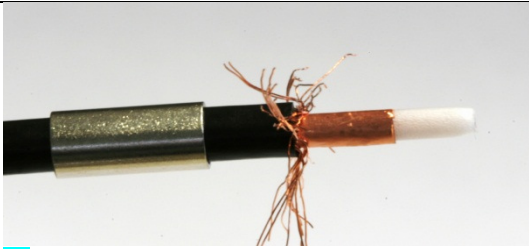
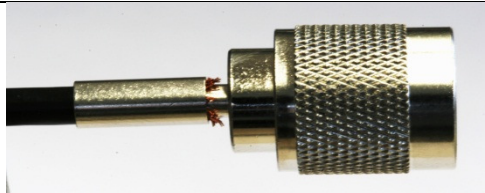
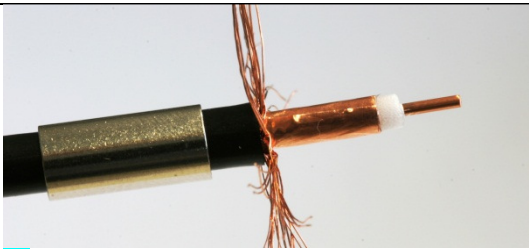
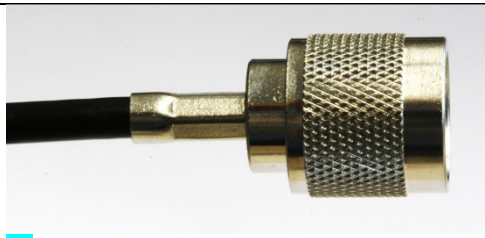


Mounting instruction

AIRCELL®5

N-Connector, crimp/ Art. No. 7701

| | |
|--|---|
|  <p>1. Cut off cable tail right-angled. Move the crimp-cover over the cable head. Cut off 16 mm of the outer sheathing with a knife.</p> |  <p>5. Put the head pin onto the inner conductor and solder/crimp it.</p> |
|  <p>2. Bend copper braid upwards right-angled.</p> |  <p>6. Insert the prepared cable end into the connector housing as far as it will go (Click).</p> |
|  <p>3. Slit slightly a length of 8 mm of the copper foil and remove it.</p> |  <p>7. Cut off the copper braid with a side cutter and move the crimp jacket to the front.</p> |
|  <p>4. Remove 6 mm of the dielectric.</p> |  <p>8. Crimp the crimp jacket with a crimp tool; herewith the copper braid will be trapped between the crimp jacket and the connector housing.</p> |